

General Report No. 1786.

Individual Report No. 6.

Risk Nos. 14, 36 and 45.

Risk: (See Summary.)

Location: Franklin Co. (See Summary.)

Owner & Occupant: The Columbus Railway & Light Co.

Date: May, 1909.

See Map No. 6.




SUMMARIES.

Risk No. 14 Car Storage House, Westerville, Ohio A 1 story brick car storage house 20 feet to the eaves. Walls are 12 inch and pilastered. Area is 30 by 75 feet equalling 2250 square feet. Roof is of metal on 7-8 inch wooden sheathing supported by metal trusses set on metal posts, bricked in. Floors are earth. The risk is not **exposed** and is **occupied** for the storage of one car over night only. Trolley wires are properly supported on insulated hangers but do not have sufficient clearance at the doors and have no **cutout switch** or lightning arrester. There is no **heating** or **lighting** or other hazards except those inherent in the cars. The risk has neither public nor private fire protection. Insurance is carried under the general form the several items being shown in the value sheet. (SEE VALUE SHEET).

Risk No. 36. Office and dwelling building, 712 Cleveland Avenue, Milo, Ohio A 2 story brick building, with slate roof and finished interior which was formerly used as offices but which at present is either unoccupied or used for dwelling purposes. There is no public or private fire protection. Insurance of \$6800.00 is carried under ordinary policy.

Risk No. 45. Storage Battery house., Near Westerville, Ohio A 1 story frame composition roofed 30 by 60 foot storage battery house. The risk is **occupied** as a storage battery house only. There is no public or private fire protection. There is no insurance carried on this building or contents at present.

*CAR BARN
WESTERVILLE, O.
INDIVIDUAL REPORT NO. 23*

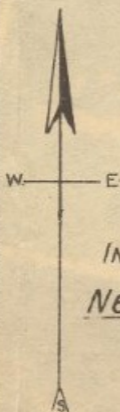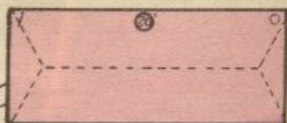

*STORAGE BATTERY HO.
INDIVIDUAL REPORT NO. 6.*

Near Westerville Ohio